



NATA Accreditation No:

14184

Transfield Services Limited

Eastlink Ambient Air Quality

Monitoring System Report

1st April 2011 – 30st June 2011

Report issue date: 14th July 2011

Maintenance contract: MC621





Customer Details	
Customer	Transfield Services Ltd
Contact name	Alex Monson
Address	Transfield Services
	PO Box 804
	Ringwood
	VIC
	3134
Email	amonson@connecteast.com.au
Phone	03 9755 1716

Report	Revision	Date	Analyst
DAT5199	0	14/07/11	DD
10 10 10 10			

Report by	David Ding	David Ding
	(name)	(signature)
		D'
NATA Signatory/Signatory	Caroline Burgess	Miges -
	(name)	(signature)



WORLD CLASS environmental MONITORING

Transfield Services Limited

CONTENTS

Customer Details	2
Revision History	2
1.0 Executive Summary	4
2.0 Introduction	5
3.0 Monitoring and Data Collection	5
3.1 Station Parameters	6
3.2 Data Collection Methods	7
3.2.1 Data Acquisition	8
3.3 Data Validation and Reporting	g
3.3.1 Validation	g
3.3.2 Reporting	g
4.0 Air Quality Goals	10
5.0 Calibrations and Maintenance	10
5.1 Units and Uncertainties	10
5.2 Maintenance	12
6.0 Results	15
6.1 Percentage Availability	15
6.2 Graphical Reports	18
7.0 Valid Data Exception Tables	24
8.0 Discussion	31
Appendix 1	32
Annendix 2	33



WORLD CLASS environmental

Transfield Services Limited

1.0 Executive Summary

EastLink is a motorway, which runs between Donvale in Melbourne's north east, to Frankston in the south-east of Melbourne. Transfield services are responsible for the operation and maintenance of the 39 kilometre road and have commissioned Ecotech P/L to monitor the ambient air quality outside the two Eastlink tunnels and provide maintenance and reporting services. CO, NOx and particulate data are monitored, along with meteorological data. Monitoring of these parameters allows any changes in the ambient air quality to be quickly identified and recorded.

The three ambient Eastlink sites are located around the north east end of the Eastlink freeway at Chaim Crt, Craig Rd and Heads Rd. Ecotech P/L commenced monitoring of these sites on June 16th 2010.

The overall percentage availability at Chaim Crt, Heads Rd and Craig Rd was above 95% for the reporting period.

No readings over the State Environmental Planning Policy (MARP) intervention levels were recorded during the reporting period.



2.0 Introduction

Ecotech P/L was commissioned by Transfield Services to provide monitoring and data reporting for the Eastlink ambient air quality monitoring network, located as detailed in Table 1. Ecotech commenced data collection from the Eastlink network on the 16th June 2010.

This report presents the data for the period April to June 2011.

The data presented in this report:

- Describes air quality measurements
- Compares monitoring results
- Has been quality assured
- Complies with NATA accreditation requirements, where applicable

3.0 Monitoring and Data Collection

The Eastlink monitoring network consists of three ambient air quality monitoring stations. Station locations and parameters monitored are described below.

Table 1: Eastlink monitoring network sites geographical co-ordinates

Site Name	Geographical Coordinates
Chaim Crt	37°48′30.55″S, 145°12′36.59″E
Craig Rd	37°48′7.85″S, 145°12′24.14″E
Heads Rd	37°48′7.39″S, 145°11′43.50″E

A sitting audit conducted on 17 June 2010 showed that the sitting of the Chaim Crt and Craig Rd sites complies with AS/NZS 3580.1.1:2007 Methods for sampling and analysis of ambient air. The Heads Rd site does not comply with the above standard as the monitoring equipment is situated too close to trees.

These sites are classified as neighbourhood stations according to AS/NZS 3580.1.1:2007 Methods for sampling and analysis of ambient air.





3.1 Station Parameters

The Eastlink monitoring stations are equipped to measure the following parameters:

Table 2: Parameters measured at the Eastlink ambient monitoring sites

Station	Parameter Measured	Instrument	
	NO, NO ₂ , NO _x	Ecotech EC9841	
	СО	Ecotech EC9830	
	PM_{10}	Rupprecht & Patashnick TEOM	
	PM _{2.5}	Rupprecht & Patashnick TEOM FDMS	
Chaim Crt	Wind Speed	Vaisala WS425	
	Wind Direction	Vaisala WS425	
	Ambient Temperature	Vaisala HMP45A	
	Relative Humidity	Vaisala HMP45A	
	Solar Radiation	Middleton Solar Pyranometer SK-01-D2	
	NO, NO ₂ , NO _x	Ecotech EC9841	
	СО	Ecotech EC9830	
	PM_{10}	Rupprecht & Patashnick TEOM	
Craig Rd	Wind Speed	Vaisala WS425	
-	Wind Direction	Vaisala WS425	
	Ambient Temperature	Vaisala HMP45A	
	Relative Humidity	Vaisala HMP45A	
	NO, NO ₂ , NO _x	Ecotech EC9841	
	СО	Ecotech EC9830	
	PM_{10}	Rupprecht & Patashnick TEOM	
Heads Rd	Wind Speed	Vaisala WS425	
	Wind Direction	Vaisala WS425	
	Ambient Temperature	Vaisala HMP45A	
	Relative Humidity	Vaisala HMP45A	





3.2 Data Collection Methods

The following methods are used for data collection:

Table 3: Methods

Parameter Measured	Method	Description
NO, NO ₂ , NO _x	AS 3580.5.1-1993	Methods for sampling and analysis of ambient air. Method 5.1: Determination of oxides of nitrogen - Chemiluminescence method
со	AS 3580.7.1-1993	Methods for sampling and analysis of ambient air. Method 7.1: Determination of carbon monoxide – Direct-reading instrumental method
PM ₁₀ (TEOM)	AS 3580.9.8-2008	Methods for sampling and analysis of ambient air. Method 9.8: Determination of suspended particulate matter - PM ₁₀ continuous direct mass method using a tapered element oscillating microbalance analyser.
PM _{2.5} (TEOM FDMS)	In-house method 7.3	In-house Method 7.3: Determination of suspended particulate matter – PM ₁₀ and PM _{2.5} continuous direct mass method using a tapered element oscillating microbalance analyser.
Wind Speed	AS 2923-1987	Ambient Air – Guide for measurement of horizontal wind for air quality applications
Wind Direction	AS 2923-1987	Ambient Air – Guide for measurement of horizontal wind for air quality applications





Table 3: Methods (continued)

Parameter Measured	Method	Description
Sigma	AS 2923-1987	Ambient Air – Guide for measurement of horizontal wind for air quality applications
Ambient Temperature	US EPA 454/R-99-005	Meterological Monitoring Guidance for Regulatory Modeling Applications
Relative Humidity	US EPA 454/R-99-005	Meterological Monitoring Guidance for Regulatory Modeling Applications
Solar Radiation	US EPA 454/R-99-005	Meterological Monitoring Guidance for Regulatory Modeling Applications

Note: The horizontal wind sensor sitting does not meet the AS2923 requirements.

3.2.1 Data Acquisition

Data acquisition is done using a PC based WinAQMS logger (using WinCollect® Version 4.0 & WinAQMS® Version 2.0) situated at each of the three monitoring sites; Chaim Crt, Craig Rd and Heads Rd. Each logger is equipped with a 3G modem for remote data collection. The recorded data is remotely collected from the AQMS loggers on a daily basis and stored at Ecotech's Environmental Reporting Services (ERS) department in Melbourne. Data samples are logged in 5 minute intervals.





Transfield Services Limited

3.3 Data Validation and Reporting

3.3.1 Validation

The Ecotech ERS department perform daily data checks to ensure maximum data capture rates are maintained. Any equipment failures are communicated to the responsible field engineers for urgent rectification. Ecotech ERS maintains two distinct databases containing non-validated and validated data respectively.

The validated database is created by duplicating the non-validated database and then flagging data affected by instrument faults, calibrations and other maintenance activities. The data validation software requires the analyst to supply a valid reason (e.g. backed by maintenance notes, calibration sheets etc) in the database for flagging any data as invalid.

Validation is performed by the operator, and the validation is reviewed. All data is checked and graphs and reports are generated based on the verified 5 minute data.

3.3.2 Reporting

The reported data is in 3 Microsoft Excel format files named "Chaim Crt Data Report Apr_Jun11.xls", "Craig Rd Data Report Apr_Jun11.xls" and "Heads Rd Data Report Apr_Jun11.xls".

Each Excel file consists of 4 Excel spreadsheets:

- 1. Cover
- 2. 1 Hour Data
- 3. 24 Hour Data
- 4. Valid Data Exception Table

The data contained in these reports is based on Australian Eastern Standard Time. Data is for all parameters measured continuously. All averages are calculated from the 5 minute data.

Averaging times are reported for the end of the period, i.e. the hourly average 02:00am is for the data collected from 1:00am to 2:00am.



4.0 Air Quality Goals

The air quality goal requirements for particulates at the Eastlink monitoring network sites are shown below.

Table 4: MARP Schedule B Intervention Levels

Parameter	Time Period	Intervention Level	Units
NO ₂	1 hour	140	ppb
СО	1 hour	29	ppm
PM ₁₀	24 hour	60	μg/m³
PM _{2.5}	24 hour	36	μg/m³

5.0 Calibrations and Maintenance

5.1 Units and Uncertainties

The uncertainties for each parameter have been determined by the manufacturers tolerance limits of the equipment's parameters, and by the applicable Australian Standard.

Table 5: Units and Uncertainties

Parameter	Units	Resolution	Uncertainty	Range
NO	ppb	1 ppb	± 14 ppb K factor of 2.01	0 ppb to 500 ppb
NO ₂	ppb	1 ppb	± 16 ppb K factor of 2.01	0 ppb to 500 ppb
NO _x	ppb	1 ppb	± 14 ppb K factor of 2.01	0 ppb to 500 ppb
СО	ppm	0.1 ppm	± 1.1 ppm K factor of 2	0 ppm to 50 ppm

Table 5: Units and Uncertainties (continued)

Parameter	Units	Resolution	Uncertainty	Range
PM ₁₀ (TEOM)	μg/m³	0.1 μg/m³	±5.0 μg/m³ or 3.6% of reading, whichever is the greater K factor of 1.96	0 μg/m³ to several g/m³
PM _{2.5} (TEOM FDMS)	μg/m³	0.1 μg/m³	±5.0 μg/m³ or 3.6% of reading, whichever is the greater K factor of 1.96	0 μg/m³ to several g/m³
Vector Wind Speed	m/s	0.1 m/s	±0.22 m/s or 3.0% of reading, whichever is greater K factor of 1.96	0 m/s to 15 m/s
Vector Wind Direction	Deg (°)	1°	±4.0° K factor 2.11	0° to 360°
Solar Radiation	W/m²	1 W/m²	± 5 % of reading or ±32 w/m² or whichever is greater K factor of 1.96	0 to 1100 W/m²
Ambient Temperature	°C	0.1°C	± 0.25°C K factor of 2.01	0°C to 50°C
Relative Humidity	%	1%	± 5% K factor of 2.31	0-100%

The reported uncertainties are expanded uncertainties calculated using coverage factors which give a level of confidence of approximately 95%.





5.2 Maintenance

The last calibrations for the following parameters have been performed on the indicated date. Data supplied after this time is subject to verification to be performed at the next calibration cycle.

Tables 6, 7 and 8 indicate when the particulate, gas and meteorological equipment were last calibrated.

Table 6: Chaim Court Maintenance Table April to June 2011

Parameter	Scheduled Maintenance Performed	Date Scheduled Maintenance performed	Last Calibration Date
NO, NO ₂ , NO _x	Yes	21/06/11	21/06/11
СО	Yes	21/06/11	21/06/11
PM ₁₀	Yes	21/04/11	21/04/11
PM _{2.5}	Yes	21/04/11	21/04/11
Wind Speed*	No	23/09/10	23/09/10
Wind Direction*	No	23/09/10	23/09/10
Ambient Temperature	No	N/A	17/03/11
Relative Humidity	No	N/A	17/03/11
Solar Radiation**	No	N/A	ТВА

^{*}Wind speed and direction readings covered by Ecotech's NATA scopeof accreditation between 23/09/10 and 10/06/11. The replacement sensor installed at Chaim Crt on 10/6/11 does not have a current NATA endorsed calibration certificate.

^{**}Provision of this service not covered by NATA scope of accreditation as the instrument does not have a current calibration certificate.



Table 7: Craig Rd Maintenance Table April to June 2011

Parameter	Scheduled Maintenance Performed	Date Scheduled Maintenance performed	Last Calibration Date
NO, NO ₂ , NO _x	Yes	21/06/11	21/06/11
СО	Yes	21/06/11	21/06/11
PM ₁₀	Yes	13/04/11	13/04/11
Wind Speed*	No	24/09/10	24/09/10
Wind Direction*	No	24/09/10	24/09/10
Ambient Temperature	No	N/A	28/03/11
Relative Humidity	No	N/A	28/03/11

^{*}Instrument covered by Ecotech's NATA scope of accreditation from the calibration date onwards



Table 8: Heads Rd Maintenance Table April to June 2011

Parameter	Scheduled Maintenance Performed	Date Scheduled Maintenance performed	Last Calibration Date
NO, NO ₂ , NO _x	Yes	14/06/11	14/06/11
СО	Yes	14/06/11	14/06/11
PM ₁₀	Yes	21/04/11	21/04/11
Wind Speed*	No	27/09/10	27/09/10
Wind Direction*	No	27/09/10	27/09/10
Ambient Temperature	No	N/A	17/03/11
Relative Humidity	No	N/A	17/03/11

^{*}Instrument covered by Ecotech's NATA scope of accreditation from the calibration date onwards







6.0 Results

6.1 Percentage Availability

Percentage availability is based on 1 hour averages, calculated from 5 minute data, and refers to the amount of available data collected for April to June 2011.

The percentage of available data is calculated using the following equation:

Availability = (Reported air quality data / Total data) x 100%

- Reported air quality data = Number of instrument readings which have been verified through a NATA or quality assured process as appropriate and excludes all data errors, zero data collection due to calibration, failures and planned and unplanned maintenance.
- Total data = Total number of instrument readings since the start of the term assuming no maintenance, errors, loss of data or calibration.





Table 9: Quarterly Percentage Availability for Eastlink Sites for April to June 2011

Davamatay	Chaim Crt	Craig Rd	Heads Rd
Parameter	%	%	%
NO, NO ₂ , NO _x	96	95	96
СО	94	95	96
PM ₁₀	99	99	100
PM _{2.5}	99	N/A	N/A
WS, WD, Sigma	92	100	99
AT	100	100	100
RH	100	100	100
SR	100	N/A	N/A
Overall % availability	98	98	99

^{*} Bold values indicate Overall Percentage Availability below 95%





Table 10: Exceedences Above MARP Intervention Levels for April to June 2011

Station	Parameter	Time Period	Value of Exceedence	Date of Exceedence
	NO ₂	1 hour	-	-
	со	1 hour	-	-
Chaim Crt	PM ₁₀	24 hour	-	-
	PM _{2.5}	24 hour	-	-
	NO ₂	1 hour	-	-
Craig Rd	со	1 hour	-	-
	PM_{10}	24 hour	-	-
	NO ₂	1 hour	-	-
Heads Rd	СО	1 hour	-	-
	PM ₁₀	24 hour	-	-





6.2 Graphical Reports

Validated 5 minute data for NO, NO₂, NO_x, CO, PM₁₀, PM_{2.5}, wind speed and wind direction were used to construct the following quarterly graphical representations.

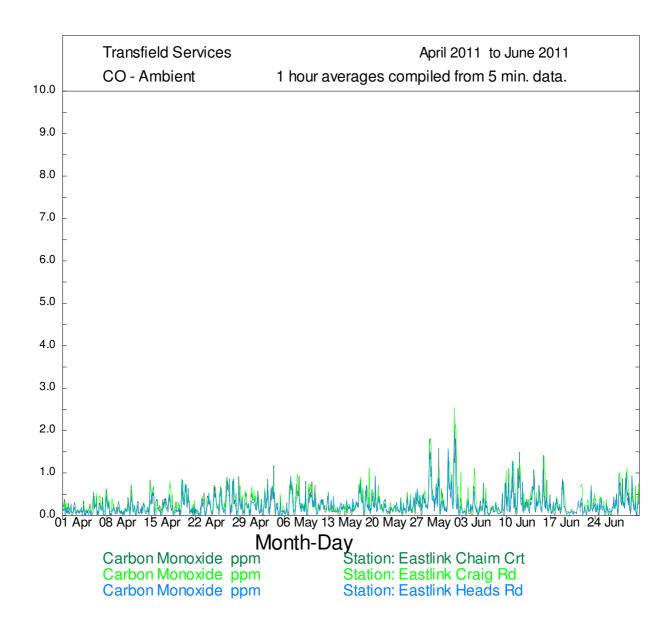


Figure 1: CO 1-hour Averages for April to June 2011



ECOTECH

WORLD CLASS

environmental

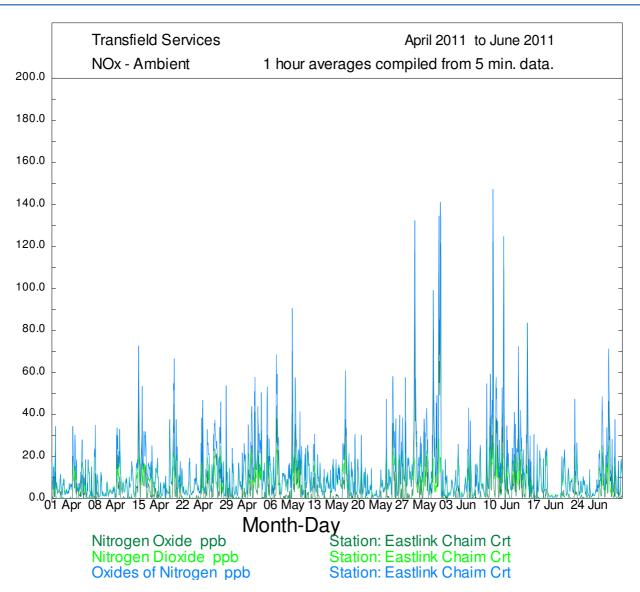


Figure 2: Chaim Crt NO, NO₂, NO_x 1-hour Averages for April to June 2011



ECOTECH

WORLD CLASS

environmental

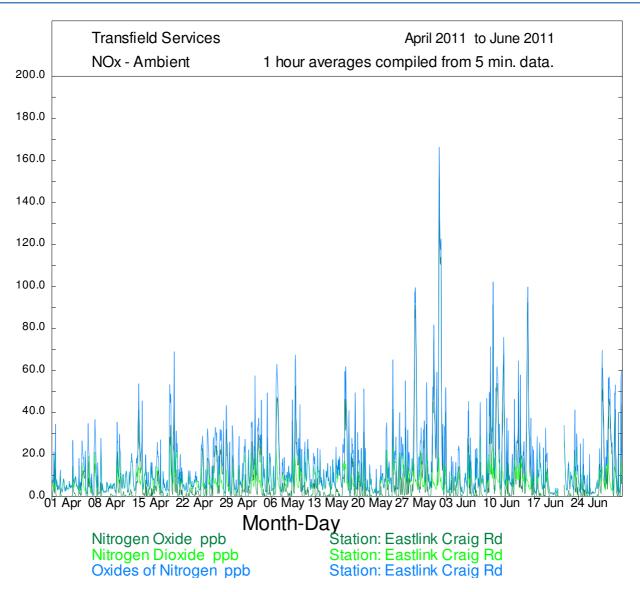


Figure 3: Craig Rd NO, NO₂, NO_x 1-hour Averages for April to June 2011



WORLD CLASS environmental

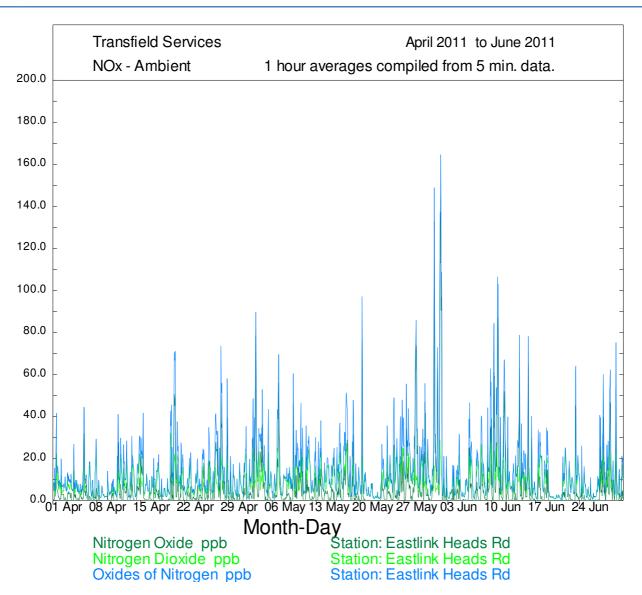


Figure 4: Heads Rd NO, NO₂, NO_x 1-hour Averages for April to June 2011



WORLD CLASS.
environmental
MONITORING

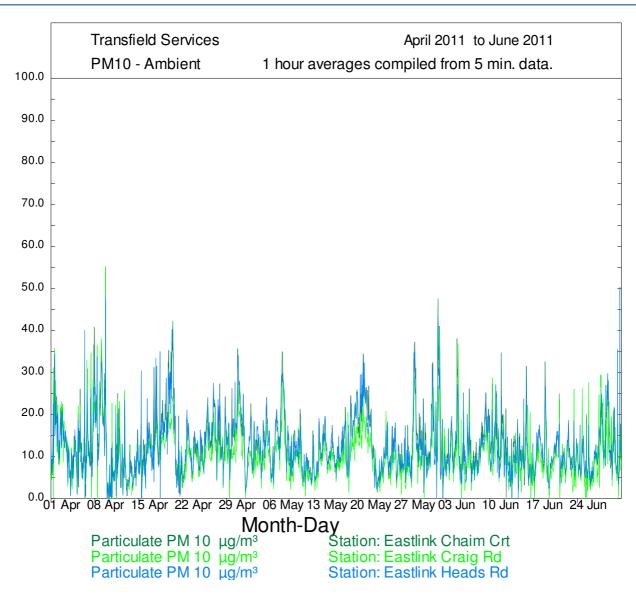


Figure 5: PM₁₀ 1-hour Averages for April to June 2011



WORLD CLASS environmental MONITORING

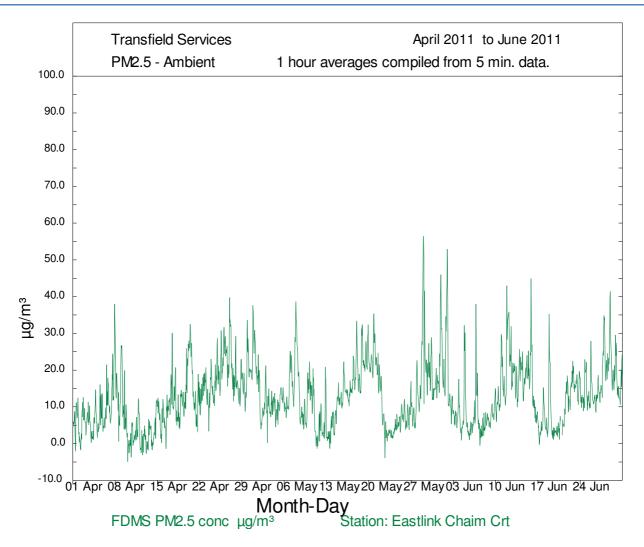


Figure 6: PM_{2.5} 1-hour Averages for April to June 2011





7.0 Valid Data Exception Tables

Table 11: Chaim Crt Valid Data Exception Table

Start Date	End Date	Reason	Change Details	User Name	Change Date
1/04/11 12:20	30/06/11 22:00	Intermittent additional automatic calibration checks	СО	DD	12/07/2011
13/04/11 12:35	13/04/11 13:25	Scheduled maintenance - monthly	СО	DD	13/05/2011
13/04/11 12:35	13/04/11 14:10	Scheduled maintenance - monthly	NO, NO ₂ , NO _x	DD	13/05/2011
20/04/11 15:50	20/04/11 15:50	Data affected by environmental conditions - wind speed spike	WS, WD, Sigma	DD	13/05/2011
21/04/11 13:10	21/04/11 15:05	Maintenance - TEOM filter change and instrument stabilisation	PM _{2.5}	DD	13/05/2011
21/04/11 13:10	21/04/11 15:40	Maintenance - TEOM filter change and instrument stabilisation	PM_{10}	DD	13/05/2011
27/04/11 13:20	27/04/11 13:45	Maintenance /instrument stabilisation following maintenance	PM _{2.5}	DD	13/05/2011
19/05/11 11:00	19/05/11 11:50	Scheduled maintenance - monthly	CO, NO, NO ₂ , NO _x	DD	14/06/2011
29/05/11 02:45	29/05/11 02:45	Data transmission error due to power interruption	All channels	DD	14/06/2011
29/05/11 02:50	29/05/11 02:50	Instrument stabilisation following power interruption	со	DD	14/06/2011
29/05/11 02:50	29/05/11 03:20	Instrument stabilisation following power interruption	PM ₁₀	DD	14/06/2011
29/05/11 02:50	29/05/11 03:25	Instrument stabilisation following power interruption	PM _{2.5}	DD	14/06/2011
4/06/11 22:35	8/06/11 12:55	Instrument fault	WS, WD, Sigma	DD	12/07/2011



Table 11: Chaim Crt Valid Data Exception Table (continued)

Start Date	End Date	Reason	Change Details	User Name	Change Date
8/06/11 13:00	10/06/11 15:20	Instrument removed for repair	WS, WD, Sigma	DD	12/07/2011
15/06/11 10:20	15/06/11 11:00	Scheduled maintenance - monthly	CO, NO, NO ₂ , NO _x	DD	12/07/2011
15/06/11 10:35	15/06/11 11:10	Scheduled maintenance - monthly	PM_{10}	DD	12/07/2011
20/06/11 12:30	20/06/11 12:30	Power interruption	All channels	DD	12/07/2011
20/06/11 12:35	20/06/11 12:35	Instrument stabilisation following power interruption	СО	DD	12/07/2011
20/06/11 12:35	20/06/11 13:05	Instrument stabilisation following power interruption	PM ₁₀	DD	12/07/2011
20/06/11 12:35	20/06/11 13:15	Instrument stabilisation following power interruption	PM _{2.5}	DD	12/07/2011
20/06/11 17:25	21/06/11 00:30	Power interruption	All channels	DD	12/07/2011
21/06/11 00:35	21/06/11 00:55	Instrument stabilisation following power interruption	NO, NO ₂ , NO _x	DD	12/07/2011
21/06/11 00:35	21/06/11 01:45	Instrument stabilisation following power interruption	PM ₁₀ , PM _{2.5}	DD	12/07/2011
21/06/11 00:35	21/06/11 12:40	Instrument fault following power interruption	со	DD	12/07/2011
21/06/11 07:30	22/06/11 12:20	Instrument fault	WS, WD, Sigma	DD	12/07/2011
21/06/11 12:50	21/06/11 13:15	Maintenance - calibration	NO, NO ₂ , NO _x	DD	12/07/2011





Table 11: Chaim Crt Valid Data Exception Table (continued)

Start Date	End Date	Reason	Change Details	User Name	Change Date
21/06/11 12:50	21/06/11 14:20	Maintenance - calibration	СО	DD	12/07/2011
22/06/11 12:25	1/07/11 14:25	Instrument removed for repair	WS, WD, Sigma	DD	12/07/2011
22/06/11 13:45	22/06/11 15:15	Unrealistic data due to maintenance	AT, RH	DD	12/07/2011
22/06/11 13:45	1/07/11 14:25	Data affected by mast was down	SR	DD	12/07/2011



Table 12: Craig Rd Valid Data Exception

Start Date	End Date	Reason	Change Details	User Name	Change Date
2/04/11 16:50	21/04/11 06:40	Data affected intermittently by environmental conditions - wind speed spike	WS, WD, Sigma	DD	13/05/2011
8/04/11 09:55	8/04/11 11:05	Maintenance - calibration	CO, NO, NO ₂ , NOx	DD	13/05/2011
13/04/11 14:50	13/04/11 15:20	Scheduled maintenance - monthly	СО	DD	13/05/2011
13/04/11 14:50	13/04/11 16:20	Scheduled maintenance - monthly	NO, NO ₂ , NO _x	DD	13/05/2011
13/04/11 15:20	13/04/11 19:45	Maintenance - TEOM filter change and instrument stabilisation	PM ₁₀	DD	13/05/2011
4/05/11 16:15	30/05/11 07:35	Data affected intermittently by environmental conditions - wind speed spike	WS, WD, Sigma	DD	14/06/2011
19/05/11 12:10	19/05/11 13:05	Scheduled maintenance - monthly	CO, NO, NO ₂ , NO _x	DD	14/06/2011
29/05/11 02:45	29/05/11 02:45	Data transmission error due to power interruption	All channels	DD	14/06/2011
29/05/11 02:50	29/05/11 02:50	Instrument stabilisation following power interruption	СО	DD	14/06/2011
29/05/11 02:50	29/05/11 03:20	Instrument stabilisation following power interruption	PM ₁₀	DD	14/06/2011
1/06/11 09:05	30/06/11 07:25	Data affected intermittently by environmental conditions - wind speed spike	WS, WD, Sigma	DD	12/07/2011
20/06/11 12:30	20/06/11 12:30	Power interruption	All channels	DD	12/07/2011





Table 12: Craig Rd Valid Data Exception Table (continued)

Start Date	End Date	Reason	Change Details	User Name	Change Date
20/06/11 12:35	20/06/11 12:35	Instrument stabilisation following power interruption	со	DD	12/07/2011
20/06/11 12:35	20/06/11 13:05	Instrument stabilisation following power interruption	PM ₁₀	DD	12/07/2011
20/06/11 17:20	21/06/11 00:30	Power interruption	All channels	DD	12/07/2011
21/06/11 00:35	21/06/11 01:45	Instrument stabilisation following power interruption	PM ₁₀	DD	12/07/2011
21/06/11 00:35	21/06/11 14:40	Instrument fault following power interruption	CO, NO, NO ₂ , NO _x	DD	12/07/2011
21/06/11 14:45	21/06/11 16:45	Scheduled maintenance - monthly	CO, NO, NO ₂ , NO _x	DD	12/07/2011



Table 13: Heads Rd Valid Data Exception Table

Start Date	End Date	Reason	Change Details	User Name	Change Date
1/04/11 06:25	30/04/11 08:05	Data affected intermittently by environmental conditions - wind speed spike	WS, WD, Sigma	DD	13/05/2011
21/04/11 11:55	21/04/11 12:45	Scheduled maintenance - monthly	CO, NO, NO ₂ , NO _x	DD	13/05/2011
21/04/11 12:00	21/04/11 13:50	Maintenance - TEOM filter change and instrument stabilisation	PM ₁₀	DD	13/05/2011
2/05/11 07:50	31/05/11 08:55	Data affected intermittently by environmental conditions - wind speed spike	WS, WD, Sigma	DD	14/06/2011
9/05/11 15:35	9/05/11 17:10	Swapped instrument and recalibrated	СО	DD	14/06/2011
9/05/11 15:35	9/05/11 16:40	Maintenance - calibration	NO, NO ₂ , NO _x	DD	14/06/2011
9/05/11 17:35	10/05/11 16:45	Intermittent additional automatic calibration checks	со	DD	14/06/2011
19/05/11 13:40	19/05/11 14:40	Scheduled maintenance - monthly	CO, NO, NO ₂ , NO _x	DD	14/06/2011
2/06/11 08:10	30/06/11 07:45	Data affected intermittently by environmental conditions - wind speed spike	WS, WD, Sigma	DD	12/07/2011
14/06/11 13:25	14/06/11 14:20	Scheduled maintenance - monthly	CO, NO, NO ₂ , NO _x	DD	12/07/2011
14/06/11 13:35	14/06/11 14:50	Scheduled maintenance - monthly	PM ₁₀	DD	12/07/2011
14/06/11 15:20	25/06/11 11:40	Intermittent additional automatic calibration checks	СО	DD	12/07/2011



WORLD CLASS environmental MONITORING

Table 13: Heads Rd Valid Data Exception Table (continued)

Start Date	End Date	Reason	Change Details	User Name	Change Date
25/06/11 08:50	25/06/11 08:50	Power interruption	All channels	DD	12/07/2011
25/06/11 08:55	25/06/11 09:15	Instrument stabilisation following power interruption	PM ₁₀	DD	12/07/2011
25/06/11 08:55	25/06/11 09:10	Instrument stabilisation following power interruption	NO, NO ₂ , NO _x	DD	12/07/2011
25/06/11 08:55	25/06/11 09:35	Instrument stabilisation following power interruption	со	DD	12/07/2011





Transfield Services Limited

8.0 Discussion

- Percentage availability for all parameters at Chaim Crt, except carbon monoxide and WS, WD, was above 95% for the reporting period. The percentage availability for carbon monoxide was low, at 94%, due to power interruptions. The percentage availability for WS, WD was low, at 92%, due to instrument being removed for repair.
- Percentage availability for all parameters at the Craig Rd station was above 95% for the reporting period.
- Percentage availability for all parameters at Heads Rd was above 95%.
- There were no recorded readings over the MARP intervention levels for the reporting period.

 END OF REPORT	





Appendix 1

Definitions

NO: Nitric oxide

NO₂: Nitrogen dioxide

NO_x: Oxides of nitrogen

CO: Carbon monoxide

PM₁₀: Particulate less than 10 microns

PM_{2.5}: Particulate less than 2.5 microns

PM_{2.5}_B: PM_{2.5} base mass (without volatiles)

PM_{2.5}_R: PM_{2.5} with volatiles

WS: Vector wind speed

WD: Vector wind direction

AT: Ambient Temperature

RH: Relative Humidity

SR: Solar Radiation

ppb: Parts per billion

ppm: Parts per million

μg/m³: micrograms per cubic metre @ standard temperature and pressure (0°C and 101.3

kPa)

m/s: metres per second

deg: degrees (True North)

W/m²: Watts per square metre





Appendix 2

Explanation of Exception Table

Logger update and site integration refers to the initial handover and setup time of the instrument when it is first installed and the channels are stabilizing.

Data transmission error refers to a period of time when the instrument could not transmit data. This may be due to interference, or a problem with the phone line or modem.

Instrument fault refers to a period of time when the instrument was not in the normal operating mode and did not measure a representative value of the existing conditions.

Instrument out of service refers to a lack of data due to an instrument being shut down for repair, maintenance or factory calibration.

Maintenance refers to a period of time when the logger / instrument was switched off due to maintenance.

Power Interruption refers to no power to the station, therefore no data was collected at this time